



File In Section: 07 - Transmission/Transaxle

Bulletin No.: 01-07-30-032B

Date: November, 2004

Service Bulletin



TECHNICAL

Subject: Transmission Oil Leaking From Transmission Vent (Replace Transmission Case Cover Gasket/Channel Plate Gasket)

Models: 1997–2005 Cars and Light Duty Trucks
With Hydra-Matic 4T65-E Automatic Transmission (RPOs MN3, MN7, M15, M76)

This bulletin is being revised to add additional model years. Please discard Corporate Bulletin Number 01-07-30-032A (Section 07 — Transmission/Transaxle).


Condition

Some owners may comment on a transmission oil leak.

Cause

This condition may be caused by an improperly torqued channel plate gasket.

Correction

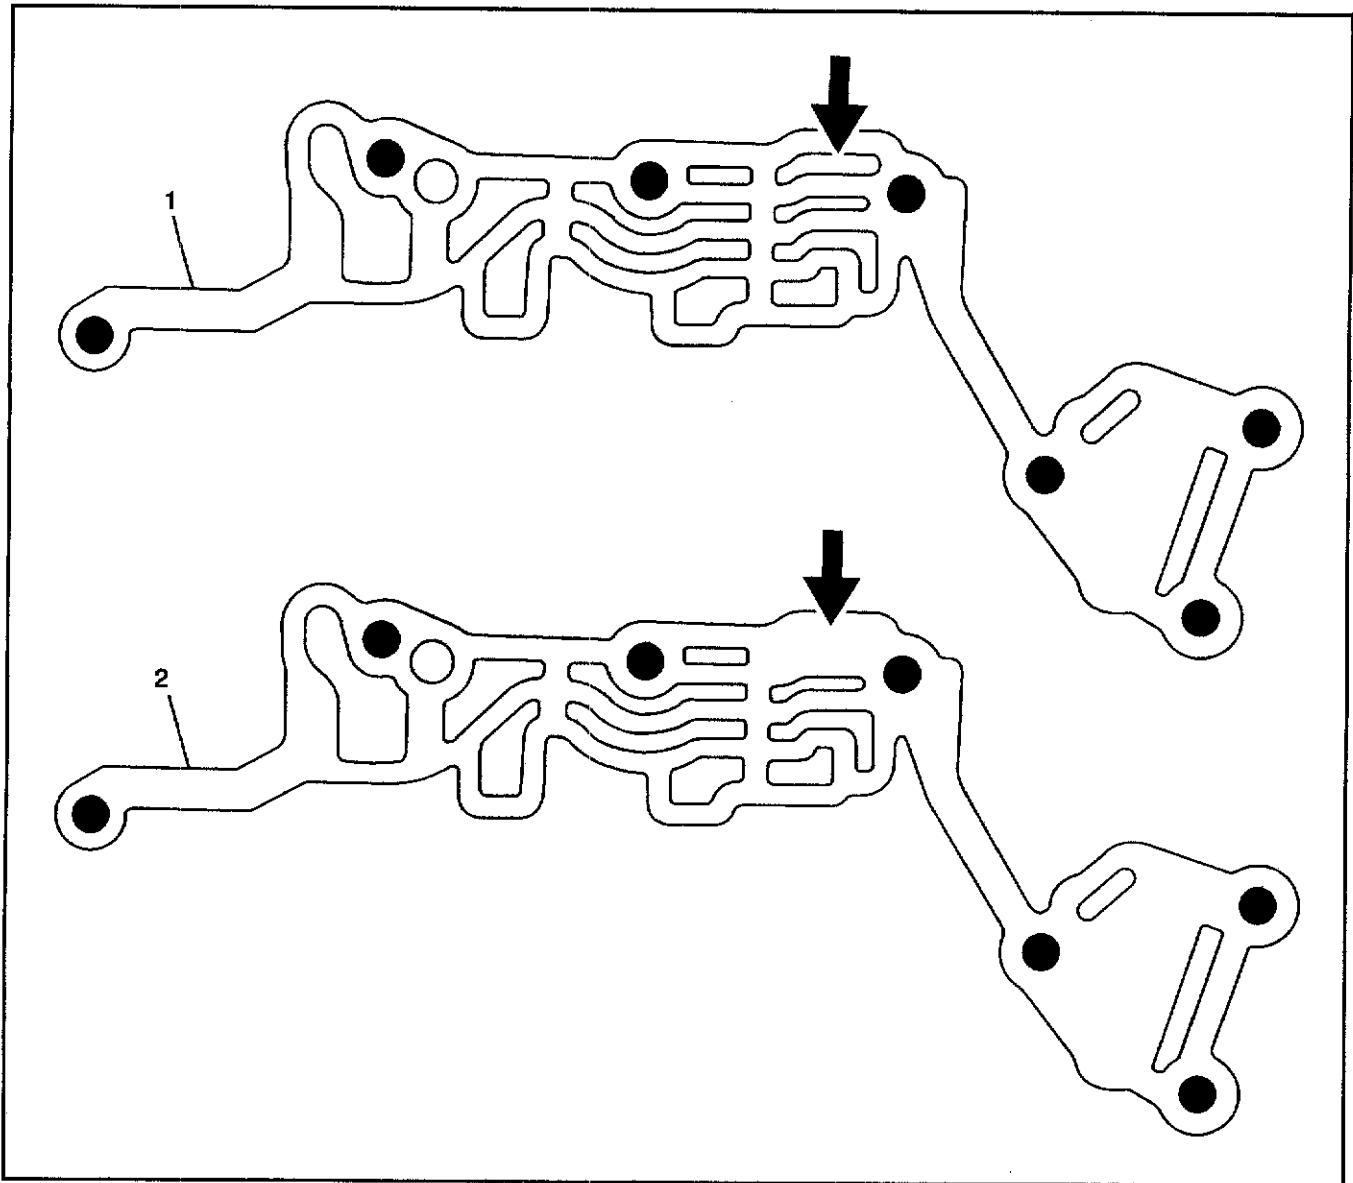

838478

To correct this condition, replace the channel plate gaskets (#429 and #430). Refer to Case Side Cover Replacement in the Automatic Transaxle – 4T65-E subsection of the appropriate Service Manual.

Parts Information

Part Number	Description	Qty
24206391	Gasket Kit, A/Trns Case Cvr	1

Parts are currently available from GMSPO.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
K7462	Channel Plate and/or Gasket — Replace	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION